
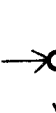



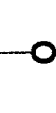
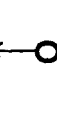

















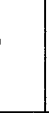



**Zestawienie studzienek Ø 1200 w zlewni przepompowni P-2**

L P	S	SCHEMAT POLĄCZ.	N <sub>1</sub> MNPM	N <sub>2</sub> MNPM	N <sub>3</sub> MNPM	N <sub>4</sub> MNPM	D <sub>1</sub> MM	D <sub>2</sub> MM	D <sub>3</sub> MM	H CM	H <sub>1</sub> CM	H <sub>2</sub> CM	PODST. Ø 1200 MM	KRAĞ. Ø 1200 h=300	KRAĞ. Ø 1200 h=500	KRAĞ. Ø 1200 h=1000	PŁYTA Ø 1200 MM	Pierścien		
																		625/50	18	625/80
1		2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	
2.1			184.15	181.58	182.03	---	200	200	200	267	139	9	1	1	---	1	1	---	---	
2.2.			184.70	181.68	---	---	200	200	---	302	184	4	1	1	1	1	1	1	---	
2.3.			185.40	181.82	---	---	200	200	---	368	240	10	1	1	---	2	1	2	---	
2.4.			185.40	181.92	---	---	200	200	---	348	230	---	1	1	---	2	1	---	---	
2.5.			185.00	182.06	---	---	200	200	---	294	176	16	1	2	---	1	1	---	2	
2.6.			184.80	182.13	---	---	200	200	---	267	149	19	1	1	---	1	1	4	---	
2.7.			184.60	182.26	---	---	200	200	---	234	116	16	1	---	---	1	1	---	2	

2.8.		184.90	182.51	---	---	200	200	---	200	200	239	121	1	1	4	---	---	1	---	---	
2.9.		184.80	182.63	---	---	200	200	---	200	200	217	99	9	1	3	---	---	1	---	1	
2.10.		184.80	182.73	---	---	200	200	---	200	200	207	89	9	1	1	1	---	---	1	---	1
2.11.		184.90	182.84	---	---	200	200	---	200	200	206	88	8	1	1	1	---	---	1	---	1
2.12.		185.00	182.87	182.97	---	200	200	200	200	213	95	5	5	1	3	---	---	1	---	1	---
2.13.		185.00	183.11	---	---	200	200	---	200	189	71	11	11	1	2	---	---	1	---	2	---
2.14.		185.40	183.20	---	---	200	200	---	200	220	102	2	2	1	---	---	---	1	---	---	---
2.15.		185.70	183.30	183.30	---	200	200	200	200	240	122	2	2	1	4	---	---	1	---	---	---
2.16.		186.20	183.44	---	---	200	200	---	200	276	158	8	8	1	---	---	1	1	1	---	1

2.17.		186.00	183.50	---	---	---	---	---	---	250	132	2	1	1	1	1	---	---	---	
2.18.	W ODRĘBNYM ZESTAWIENIU (studzienka TEGRA Ø 600)																			
2.19.		186.10	183.70	183.70	---	200	200	200	200	200	240	122	2	1	4	---	---	---	---	---
2.20.		186.47	184.32	---	---	200	200	200	200	---	215	97	7	1	3	---	---	---	---	1
2.21.		186.66	184.51	---	---	200	200	200	200	---	215	97	7	1	3	---	---	---	---	1
2.22.		187.30	184.85	---	---	200	200	200	200	---	245	127	7	1	4	---	---	---	---	1
2.23.		187.80	185.09	---	---	200	200	200	200	---	271	153	3	1	1	1	1	---	---	---
2.24.		187.95	185.32	---	---	200	200	200	200	---	263	145	15	1	1	1	1	---	---	3
2.25.		188.00	185.40	---	---	200	200	200	200	---	260	142	12	1	1	1	1	---	---	1

2.26.		185.20	185.56	---	---	200	200	---	264	146	16	1	1	---	1	1	---	2
2.27.		185.35	185.79	---	---	200	200	---	256	138	8	1	1	---	1	1	---	1
2.28.		185.00	186.10	---	---	200	200	---	190	72	12	1	2	---	---	1	1	1
2.29.		185.55	186.59	---	---	200	200	---	196	78	18	1	2	---	---	1	2	1
2.30.		185.60	186.64	---	---	200	200	---	196	78	18	1	2	---	---	1	2	1
2.31.		185.10	186.90	---	---	200	200	---	220	102	2	1	---	---	1	1	---	---
2.32.		190.10	187.90	---	---	200	200	---	220	102	2	1	---	---	1	1	---	---
2.33.		190.48	188.33	---	---	200	200	---	215	97	7	1	3	---	---	1	---	1
2.34.		190.50	188.50	---	---	200	200	---	200	82	2	1	1	1	---	1	---	---










2.36.		191.60	189.30	189.60	---	200	200	---	230	112	12	1	---	---	1	1	1	1	1
2.36.		192.25	190.05	---	---	200	200	---	220	102	2	1	---	---	1	1	1	---	---
2.37.		192.70	190.60	---	---	200	200	---	210	92	2	1	3	---	---	1	---	---	---
2.38.		192.90	190.80	---	---	200	200	---	210	92	2	1	3	---	---	1	---	---	---
2.39.		193.10	191.00	---	---	200	200	---	210	92	2	1	3	---	---	1	---	---	---
2.40.		193.65	191.45	---	---	200	200	---	220	102	2	1	---	---	1	1	---	---	---
2.41.		193.85	191.75	---	---	200	200	---	210	92	2	1	3	---	---	1	---	---	---
2.42.		194.55	192.35	192.75	---	200	200	---	230	102	2	1	---	---	1	1	---	---	---
2.43.		195.90	193.80	---	---	200	200	---	210	92	2	1	3	---	---	1	---	---	---




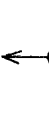
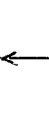
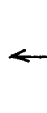
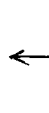


2.44.		196.45	194.21	---	---	200	200	---	224	106	6	1	---	---	1	1	1	---
2.45.		197.00	194.54	---	---	200	200	---	246	128	8	1	4	---	---	1	---	1
2.46.		197.10	194.80	---	---	200	---	---	230	102	---	1	4	---	---	1	---	---
2.47.		185.95	183.84	---	---	200	200	---	211	92	3	1	3	---	---	1	---	---
2.48.		186.00	184.00	---	---	200	---	---	200	82	2	1	1	1	---	1	---	---
2.49.		185.30	183.37	---	---	200	200	---	193	75	15	1	2	---	---	1	3	---
2.50.		185.40	183.58	---	---	200	---	---	182	64	4	1	2	---	---	1	1	---
2.51.		186.10	183.70	---	---	200	200	---	240	122	2	1	4	---	---	1	---	---
2.52.		187.10	184.60	---	---	200	200	---	250	112	12	1	---	---	1	1	1	1










2.53.		187.65	184.82	---	---	200	200	200	---	273	155	5	1	---	1	1	1	1	---	
2.54.		187.70	184.94	---	---	200	200	200	---	276	158	8	1	---	1	1	1	1	1	
2.55.		188.10	185.15	---	---	200	200	200	---	295	177	17	1	2	---	1	1	1	2	1
2.56.		187.70	185.26	---	---	200	200	200	---	245	127	7	1	4	---	---	1	1	---	1
2.57		187.70	185.27	185.27	---	200	200	200	200	243	125	5	1	4	---	---	1	1	---	1
2.58.		187.80	185.45	---	---	200	200	200	---	235	117	17	1	---	---	1	1	1	2	1
2.59.		188.00	185.80	185.80	---	200	200	200	200	220	102	2	1	---	---	1	1	1	---	---
2.60.		188.90	186.60	---	---	200	200	200	---	230	112	12	1	---	---	1	1	1	1	1
2.61		188.55	186.77	187.22	---	200	200	200	200	268	150	---	1	---	1	1	1	1	---	---

2.62.		189.30	187.02	---	---	200	200	---	228	110	10	1	---	---	1	1	1	2	---
2.63.		189.40	187.10	---	---	200	200	---	230	112	12	1	---	---	1	1	1	1	1
2.64.		189.50	187.50	---	---	200	200	---	200	82	2	1	1	---	---	1	1	---	---
2.65.		189.40	187.63	---	---	200	200	---	177	59	9	1	---	---	1	1	1	---	1
2.66.		189.55	187.79	---	---	200	200	---	176	58	8	1	---	---	1	1	1	---	1
2.67.		189.80	188.10	---	---	200	---	---	170	52	2	1	---	---	1	1	1	---	---
2.68.		189.60	187.29	---	---	200	200	---	231	113	13	1	---	---	1	1	1	1	1
2.69.		189.70	187.44	---	---	200	200	---	226	108	8	1	---	---	1	1	1	---	1
2.70.		189.70	187.60	---	---	200	200	---	210	92	2	1	1	3	---	1	1	---	---



2.71.		189.80	188.15	---	---	200	---	200	---	---	165	47	17	1	---	---	1	---	1	2	1	1
2.72		187.75	185.44	---	---	200	200	---	---	231	118	18	1	---	---	---	1	---	1	2	1	1
2.73		188.00	185.67	---	---	200	200	---	---	233	115	15	1	---	---	---	1	---	1	3	---	---
2.74.		188.15	185.69	---	---	200	200	---	---	246	128	8	1	4	---	---	1	---	1	---	---	1
2.75.		188.50	185.80	---	---	200	200	---	---	270	152	2	1	---	1	1	1	---	1	---	---	---
2.76.		188.65	185.92	---	---	200	200	---	---	273	155	5	1	---	1	1	1	---	1	1	---	---
2.77.		188.50	186.00	---	---	200	---	200	---	250	132	12	1	4	---	---	1	---	1	1	---	1
2.78.		188.20	185.87	---	---	200	200	---	---	233	115	15	1	---	---	---	1	---	1	3	---	---
2.79.		188.40	186.00	---	---	200	200	---	---	240	122	2	1	4	---	---	1	---	1	---	---	---

2.80.		188.35	186.22	---	---	200	200	---	213	95	15	1	3	---	---	1	3	---
2.81.		188.45	186.47	---	---	200	200	---	198	80	---	1	1	1	---	1	---	---
2.82.		188.50	186.67	---	---	200	---	---	183	65	5	1	2	---	---	1	5	---
2.83.		184.40	182.50	---	---	200	200	---	190	72	12	1	2	---	---	1	1	1
2.84.		184.10	182.60	---	---	200	200	---	150	32	2	1	1	---	---	1	---	---
2.85.		184.35	182.85	---	---	200	200	---	150	32	2	1	1	---	---	1	---	---
2.86.		186.35	184.65	---	---	200	200	---	170	52	2	1	---	1	---	1	---	---
2.87.		188.15	186.06	186.06	---	200	200	200	209	91	1	1	3	---	---	1	---	---
2.88.		188.20	186.11	---	---	200	200	---	209	91	1	1	3	---	---	1	---	---

2.89.		188.25	186.18	---	---	200	200	---	207	89	9	1	1	1	1	---	1	---	1
2.90.		188.30	186.30	187.56	---	200	200	200	200	82	2	1	1	1	1	---	1	---	---
2.91.		188.35	186.38	---	---	200	200	---	197	79	19	1	2	---	---	1	2	---	1
2.92.		188.50	186.48	---	---	200	200	---	202	84	4	1	1	1	---	1	1	---	---
2.93.		188.55	186.56	---	---	200	200	---	199	81	1	1	1	1	---	1	---	---	---
2.94.		188.65	186.71	---	---	200	200	---	194	76	16	1	2	---	---	1	---	---	2
2.95.		188.70	186.77	---	---	200	200	---	193	75	15	1	1	---	---	1	3	---	---
2.96.		188.75	186.87	---	---	200	200	---	188	70	10	1	2	---	---	1	2	---	---
2.97.		188.80	186.99	---	---	200	200	---	181	63	3	1	2	---	---	1	---	---	---

2.98.		189.50	187.12	---	---	200	200	---	200	200	---	120	---	1	4	---	---	1	---	---
2.99.		189.70	187.25	187.56	---	200	200	---	200	200	200	127	---	1	4	---	---	1	---	1
2.100		189.90	187.33	---	---	200	200	---	200	200	---	129	---	1	4	---	---	1	---	---
2.101		190.00	187.47	---	---	200	200	---	200	200	---	136	---	1	1	---	1	1	1	---
2.102		190.40	187.65	---	---	200	200	---	200	200	---	157	---	1	---	1	1	1	1	---
2.103		190.30	187.75	---	---	200	200	---	200	200	---	137	---	1	1	---	1	1	1	---
2.104		190.00	187.87	---	---	200	200	---	200	200	---	96	---	1	3	---	---	1	---	---
2.105		190.00	187.97	---	---	200	200	---	200	200	---	85	---	1	1	1	1	1	1	---
2.106		190.30	188.19	---	---	200	200	---	200	200	---	93	---	1	3	---	---	1	---	---

2.107		190.55	188.28	---	---	---	200	200	---	227	109	9	1	---	---	1	1	1	---	1
2.108		190.55	188.34	---	---	---	200	200	---	221	103	3	1	---	---	1	1	1	---	1
2.109		190.55	188.45	---	---	---	200	200	---	210	92	2	1	3	---	---	1	1	---	---
2.110		190.60	188.83	---	---	---	200	200	---	177	59	9	1	---	---	1	1	1	---	1
2.111		189.90	187.83	---	---	---	200	200	---	207	87	7	1	1	---	---	1	1	---	---
2.112		189.80	188.20	---	---	---	200	200	---	160	42	12	1	1	---	---	1	1	---	1
2.113		189.70	187.70	---	---	---	200	200	---	200	82	2	1	1	---	---	1	1	---	---
2.114		188.10	186.30	---	---	---	200	200	---	180	62	2	1	2	---	---	1	1	---	---
2.115		188.60	186.75	---	---	---	200	200	---	185	67	7	1	2	---	---	1	1	---	---

2.116	O →	189.10	187.31	---	---	200	---	---	179	61	1	2	---	---	1	---
-------	-----	--------	--------	-----	-----	-----	-----	-----	-----	----	---	---	-----	-----	---	-----

U W A G A - Przy zamawianiu w betoniarni prefabrykowanych podstaw studzienek, kąty wejścia przewodów i lokalizację przejść szczelnych podać po ostatecznym wytyczeniu geodezyjnym tras kanałów w terenie.